




VEKTEK, INC.  
1334 E. SIXTH AVE.  
P.O. BOX 625  
EMPORIA, KS. 66801  
U.S.A.

# PARTS LIST

PL-1543  
REV. B, ECN3242  
PAGE 1 OF 1

ASSEMBLIES AFFECTED: 15-0505-02

DRAWN/DATE JDW  
11-15-06

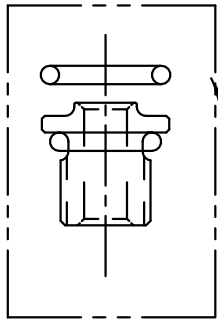

\* ADAPTOR ASS'Y.  
30-8711-20 (Std.)  
30-8711-20-F (Flouorocarbon)  
(2) REQ'D.

PLUNGER  
81-5105-00

\* & \*\* BALL 23-6000-14  
(LUBRICATE WITH "DAB"  
OF LITHIUM GREASE)

PLUG (3)  
30-6011-22

\* & \*\* BALL  
23-6000-14

\* O-RING  
39-0000-32 (Std.)  
39-0510-20 (Fluorocarbon)

BODY-- NON-  
REPLACEMENT PART

\* & \*\* GASKET  
39-T550-01

RETAINER 81-5305-01  
(RETORQUE TO 13 FT LBS.)

B.H. CAPSCREW 21-4110-01

\* WIPER  
39-0100-39 (Std.)  
39-0530-04 (Fluorocarbon)

\* ROD SEAL  
39-0100-38 (Std.)  
39-0520-14 (Fluorocarbon)  
(INSTALL LIPS DOWN)

SPRING SUPPORT  
ROD 81-5905-01

\* PISTON SEAL  
39-0100-36 (Std.)  
39-0520-10 (Fluorocarbon)  
(INSTALL LIPS UP)

\*\* SPRING  
23-3100-08

\*\* SPRING  
23-3110-17

\* INCLUDED IN SEAL KIT No. (Std.) 60-1501-00  
(Fluorocarbon) 6V-1501-00

APPLY LUBRICANT TO ALL SEAL CONTACTS TO INSTALLATION