



Lubricate all seals with clean hydraulic oil prior to assembly.
DO NOT USE SILICONE BASED LUBRICANTS

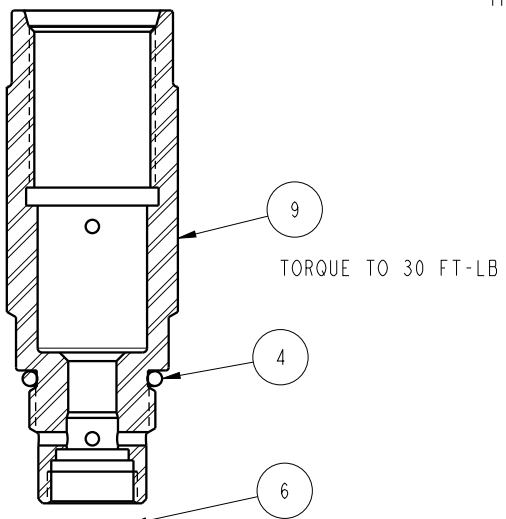


Apply one drop of medium strength thread locker (blue)
 Tighten to 30 ft lb torque

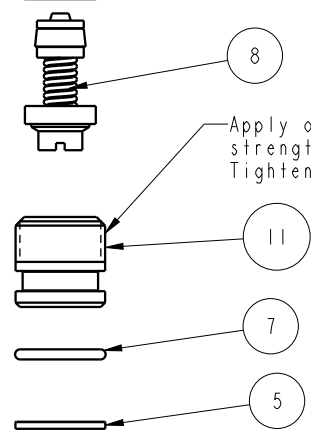

SECTION A-A

Repair Kit 60-7050-00	
39-0000-29	
70-5400-21	
39-0200-11	
39-0500-08	
39-0100-33	

No.	QTY	PART No.	DESCRIPTION
11	1	87054070	FITTING, END, PLV
10	1	87054030	STOP, SPRING, PLV
9	1	87054000	BODY, CARTRIDGE, PLV
8	1	70540021	ASSEMBLY, POPPET, PLV
7	1	39050008	O-RING, (-014)
6	1	39020011	WASHER, COPPER, .360 X .500 X .032
5	1	39010033	BU RING, (-014)
4	1	39000029	O-RING, (-115)
3	1	30601199	PLUG, SOCH, SAE 10
2	1	23314008	SPRING, COMPRESSION, DIE
1	1	21440004	SHSS, HOLLOW

PARTS LIST	 VEKTEK VEKTEK, INC. 1334 E. SIXTH AVE. P.O. BOX 625 EMPORIA, KS. 66801 U.S.A.
	ASSY, CARTRIDGE, PLV, 1500-5000 PSI
Model Numbers 70-5430-06	SIZE A
PL-7006	
FORM FEG035_PL_ASIZE, REV. B	

E	5611	RELEASE	ALS	1/23/25
REV	IN ACCORDANCE WITH ECN	EFFECTIVE DATE	REVISED BY	DATE
DRW BY:	VANDALSEM	DRAWING STATUS: ECN		
DATE:	10-30-89	PRODUCTION APPROVED FOR RELEASED STATUS ONLY		